

Snap-on[®]

EEBR312A Brake Lathe



Installation Instructions Operating Instructions Safety Instructions Maintenance Instructions

READ these instructions before placing unit in service. KEEP these and other materials delivered with the unit in a binder near the machine for ease of reference by supervisors and operators.

Snap-on[®]

IMPORTANT SAFETY INSTRUCTIONS

Before operating the lathe, review the warning information on the lathe and the cautions, warnings and dangers in this manual. Also review the following general safety instructions. Failure to follow safety instructions could result in personal injury to operator or bystanders and damage to the lathe or personal property.

READ ALL INSTRUCTIONS

When using your garage equipment, basic safety precautions should always be followed, including the following:

- 1.** Keep guards in place and in working order.
- 2.** Remove adjusting keys and wrenches from the tool before turning it on. Make this a habit.
- 3.** Keep work area clean and well lighted. Cluttered areas and benches invite accidents.
- 4.** To reduce the risk of fire, do not operate equipment in the vicinity of open containers of flammable liquids (gasoline).
- 5.** Adequate ventilation should be provided when working on operating internal combustion engines.
- 6.** Care must be taken as burns can occur from touching hot parts.
- 7.** Do not operate equipment with a damaged cord or if the equipment has been dropped or damaged—until it has been examined by a qualified serviceman.
- 8.** If an extension cord is necessary, a cord with a current rating equal to or more than that of the equipment should be used. Cords rated for less current than the equipment may overheat. Care should be taken to arrange the cord so that it will not be tripped over or pulled.
- 9.** To reduce the risk of electric shock, do not use on wet surfaces or expose to rain.
- 10.** Keep children away. All bystanders should be kept completely away from the work area.
- 11.** Make the workshop kid-proof. Use padlocks and master switches, and remove starter keys.
- 12.** Don't force a tool. It will do the job better and safer at the rate for which it was designed.
- 13.** Use the right tool. Don't force a tool or an attachment to do a job for which it was not designed.
- 14.** Dress properly. Keep hair, loose clothing, neckties, shop rags, jewelry, fingers, and all parts of body away from moving parts. Non-slip footwear is recommended.
- 15.** ALWAYS WEAR SAFETY GLASSES. Everyday eye-glasses only have impact resistant lenses, they are NOT safety glasses. Safety glasses, goggles, or a face shield will help protect the operator from injury. Use a face shield and dust mask during dusty operations.
- 16.** Secure the work properly to the unit for setup and tool bit positioning. Do not attempt to hold a drum or rotor steady on the arbor with your hands. Both hands must be free to operate unit.
- 17.** Don't overreach. Keep proper footing and balance at all times when lathe is in operation or when working around the unit.
- 18.** Maintain tools with care. Keep tools sharp and clean for best and safest performance. Follow instructions for lubricating and changing accessories.
- 19.** Remove power from the unit and disconnect tools before servicing and when changing accessories such as blades, bits, cutters, etc. Follow lock-out and tag-out procedures as required.
- 20.** Avoid unintentional starting. Make sure the switch is in the OFF (O) position before plugging the machine in or performing any maintenance or service work.
- 21.** Use of improper accessories may cause risk of injury to operator or bystanders. Use only as described in this manual. Use only manufacturer's recommended attachments.
- 22.** Never stand or lean on a lathe. Serious injury could occur if the lathe is tipped or if the cutting tool is unintentionally contacted.
- 23.** Check damaged parts carefully. Before further use of the lathe, a guard or other part that is damaged should be carefully checked. Immediately replace all damaged, missing, or non-functional parts. Check for alignment of moving parts, binding of moving parts, breakage of parts, mounting, and any other conditions that may affect operation. Guards and other parts that are damaged should be properly repaired or replaced before lathe is used again.
- 24.** Always feed the work into a blade or cutter and against the direction of rotation. Cutters and tool bits are designed to cut from the inside of a drum or rotor to the outer edge. Do not attempt to cut from the outside edge in to the center.
- 25.** Never leave tools running unattended. Turn the power off. Don't leave the tool until it comes to a complete stop.
- 26.** Never use compressed air to blow the tool clean. Chips and dust may be driven between machined parts and into bearings, causing undue wear. They may also contact persons in the area causing personal injury.
- 27.** Operate the lathe in the proper environment. The lathe incorporates parts such as snap switches and power receptacles which tend to produce arcs or sparks. Therefore, when located in a garage, the unit should be in a room or enclosure provided for the purpose, or should be at least 18" or more above the floor to minimize the risk of igniting fuel vapors.

SAVE THESE INSTRUCTIONS

Brake Lathes


Table of Contents

Important Safety Instructions	2	Maintenance and Service	18-19
Safety Notices and Decals	4	Oiling	18-19
Warnings	4	Cleaning	19
Cautions and Dangers	4	Care of Arbors and Adapters	19
Owner's Responsibility	5	Shear Gear Replacement	19
Definitions of Hazard Levels	5		
Before You Begin	6		
Receiving	6		
Electrical Requirements	6		
Installation	6		
Operating Specifications	7		
Principle Operating Parts	8		
Arbor Installation	9		
Adapters	9		
Basic Operation	9		
Spindle	9		
Spindle Feed	9		
Spindle Speed	9		
Spindle Speed Adjustment	9		
Cross Feed	9-10		
V-Belt Tension and Adjustment	10		
Basic Operation of Handwheels	10		
Reconditioning Brake Drums	11		
Preparation	11		
Mounting Drums	11-13		
Typical Drum Mounting Configurations	12		
Reconditioning Disc Brake Rotors	14		
Preparation	14		
Rotor Mounting	14		
Model 6950 Twin Cutter	14		
Typical Rotor Mounting Configurations	15		
Set Up and Reconditioning Rotors	16-18		


Brake Lathes

Safety Notices and Decals

For your safety, and the safety of others, read and understand all of the safety notices and decals included here and on the unit.

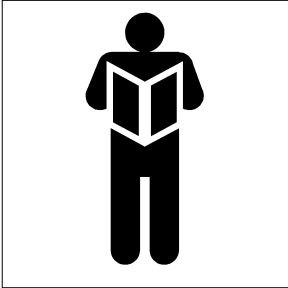

Read entire manual before installing, operating, or servicing this equipment.

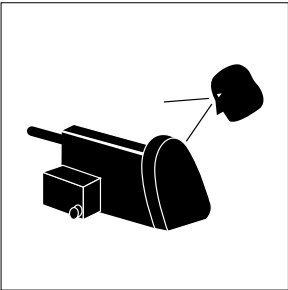

Proper maintenance and inspection is necessary for safe operation.



Do not operate a damaged lathe.

WARNING

Failure to follow danger, warning, and caution instructions may lead to serious personal injury or death to operator or bystander or damage to property. Do not operate this machine until you read and understand all the dangers, warnings and cautions in this manual.

Warnings

This equipment incorporates parts such as snap switches and power receptacles which tend to produce arcs or sparks. Therefore, when located in a service facility, the unit should be in a room or enclosure provided for the purpose, or should be at least 18" or more above floor to minimize the risk of igniting fuel vapors.

Cautions and Dangers

1. Eye and face protection requirements:
"Protective eye and face equipment is required to be used where there is a reasonable probability of injury that can be prevented by use of such equipment." OSHA 1910.133 (a).
Protective goggles, safety glasses, or a face shield must be provided by the purchaser/user and worn by the operator of the equipment. Make sure all eye and face safety precautions are followed by the operator(s). Keep bystanders out of the area.
2. Do not remove any safety equipment, belt guards, or shortcut controls or operations.
3. Make sure drums and rotors are properly and squarely mounted before starting lathe, and that all parts are secure.
4. Do not wear loose clothing, jewelry, or gloves when operating or working around a lathe.
5. Do not overload the lathe. Read and understand the lathe specifications. Overloading is poor machine tool practice, shortens the life of the lathe, and could cause a failure resulting in personal injury.

WARNING

For Your Own Safety Read Instruction Manual Before Operating Lathe

- **Wear eye protection.**
- **Do not wear gloves, necktie, or loose clothing.**
- **Tighten all locks before operating.**
- **Rotate workpiece before installing on faceplate.**
- **Risk of injury due to accidental starting.**
- **Do not use in an area where children may be present.**

941134

Brake Lathes

Owner's Responsibility

To maintain machine and user safety, the responsibility of the owner is to read and follow these instructions:

- Follow all installation instructions.
- Make sure installation conforms to all applicable Local, State, and Federal Codes, Rules, and Regulations; such as State and Federal OSHA Regulations and Electrical Codes.
- Carefully check the unit for correct initial function.
- Read and follow the safety instructions. Keep them readily available for machine operators.
- Make certain all operators are properly trained, know how to safely and correctly operate the unit, and are properly supervised.
- Allow unit operation only with all parts in place and operating safely.
- Carefully inspect the unit on a regular basis and perform all maintenance as required.
- Service and maintain the unit only with authorized or approved replacement parts.
- Keep all instructions permanently with the unit and all decals/labels/notices on the unit clean and visible.
- Do not override safety features.

Definitions of Hazard Levels

Identify the hazard levels used in this manual with the following definitions and signal words:

DANGER

Watch for this symbol:



It Means: Immediate hazards, which will result in severe personal injury or death.

WARNING

Watch for this symbol:



It Means: Hazards or unsafe practices, which could result in severe personal injury or death.

CAUTION

Watch for this symbol:



It Means: Hazards or unsafe practices, which may result in minor personal injury or product or property damage.



Watch for this symbol! It means BE ALERT! Your safety, or the safety of others, is involved!

Brake Lathes

Before You Begin

Receiving

The shipment should be thoroughly inspected as soon as it is received. The signed bill of lading is acknowledgement by the carrier of receipt in good condition of shipment covered by our invoice.

If any of the goods called for on this bill of lading are shorted or damaged, do not accept them until the carrier makes a notation on the freight bill of the shorted or damaged goods. Do this for your own protection.

NOTIFY THE CARRIER AT ONCE if any hidden loss or damage is discovered after receipt and request the carrier to make an inspection. If the carrier will not do so, prepare a signed statement to the effect that you have notified the carrier (on a specific date) and that the carrier has failed to comply with your request.

IT IS DIFFICULT TO COLLECT FOR LOSS OR DAMAGE AFTER YOU HAVE GIVEN THE CARRIER A CLEAR RECEIPT.

File your claim with the carrier promptly. Support your claim with copies of the bill of lading, freight bill, invoice, and photographs, if available.

Electrical Requirements

The lathe must be properly grounded to protect the operator from shock. The lathe is equipped with an approved 3-conductor cord and a 3-prong grounding type plug to fit the proper grounding-type receptacle. Should an extension cord be required, use 3-conductor cords with 3-prong grounding plug and 3-prong grounding receptacle properly rated to handle this electrical power tool only. Do not modify a cord or plug to match a receptacle; have a qualified electrician install an appropriate outlet to match the lathe requirements. Repair or replace any worn or damaged power cords immediately.

Verify that the lathe plug and grounding-type receptacle match as shown in Figure 1.

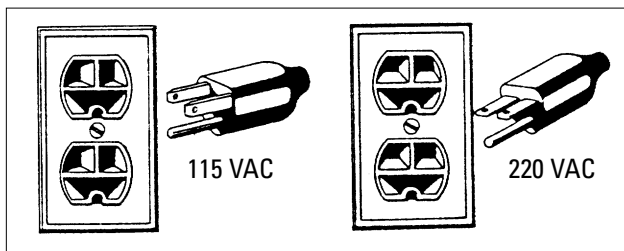


Figure 1 - Power Cord Plug and Receptacle Types

Installation

1. Assemble bench according to the instructions provided. Tighten all fasteners securely.

2. After assembly, the bench should be leveled and may be bolted down with 3/8 or 7/16 inch bolts or lag screws.

3. Unbolt the lathe from the shipping pallet. Lift the lathe onto the bench.

4. Bolt the lathe to the bench with the hardware provided. Tighten fasteners securely.

5. Remove any packing materials and protective wrapping from the lathe and components.

6. Make sure lathe is turned off. Plug lathe into a properly installed and grounded outlet that matches the lathe plug.

7. Remove the shipping plug, insert the oil dipstick, and check oil level. The lathe is shipped with the correct amount and type of oil. Add oil as necessary to reach the correct mark on the dipstick. Use only EP-80-90 gear oil. Oil level should be checked often.

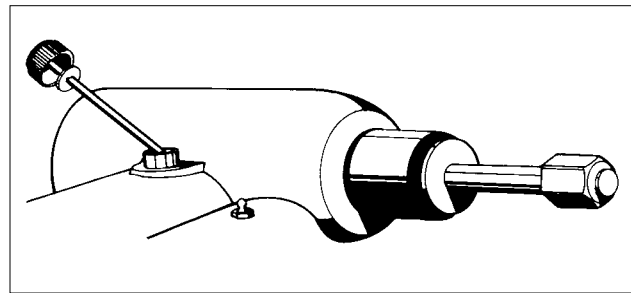


Figure 2 - Check oil level

8. Clear the area and turn lathe on. Check for proper operation (motor and spindle rotation).

Preparation for Use

1. Inspect all adapters and accessories for burrs, nicks, or other damage.

2. Clean accessories with a vaporizing solvent.

3. Apply a light film of oil to all adapters to protect their machined surfaces from rust. Refer to the maintenance section for more information.

Brake Lathes

Operating Specifications



4100

Overall lathe height	17.25" (438 mm)
Lathe shipping weight	410 lbs (186 kg)
Floor space requirements - width	48" (1219.20 mm)
Floor space requirements - deep	34.5" (901.70 mm)
Spindle to floor (mounted on optional bench)	39.375" (1000 mm)
Electrical requirements (unless otherwise specified)	115 VAC, 60 Hz, single-phase, fused at 20 amps
Spindle motor	1 HP, 60 Hz, 115/230 VAC
Spindle travel	9.875" (251 mm)
Spindle speed	
Inner groove	60 RPM
Middle groove	80 RPM
Outer groove	115 RPM
Spindle feed speed	Infinitely variable
Minimum	0.002 inch per revolution (0.05 mm/rev)
Maximum	0.020 inch per revolution (0.50 mm/rev)
Cross feed speed	
Fine	0.002
Course	0.010
Handwheel graduations	0.002 (0.050 mm)
Maximum brake rotor diameter*	14.5" (368.3 mm)
Maximum brake rotor thickness	1.875" (47.63 mm)
Brake drum diameter	
Minimum	6" (152 mm)
Maximum	28" (711 mm)
Maximum drum depth	9.875" (251 mm)
Maximum load	
1" Arbor	100 lbs. (45.36 kg)
1.875" Arbor	200 lbs. (90.72 kg)

* The no. 906936 Cross Feed Extension – increases the maximum rotor diameter to 19" (483 mm).

Brake Lathes

Principle Operating Parts

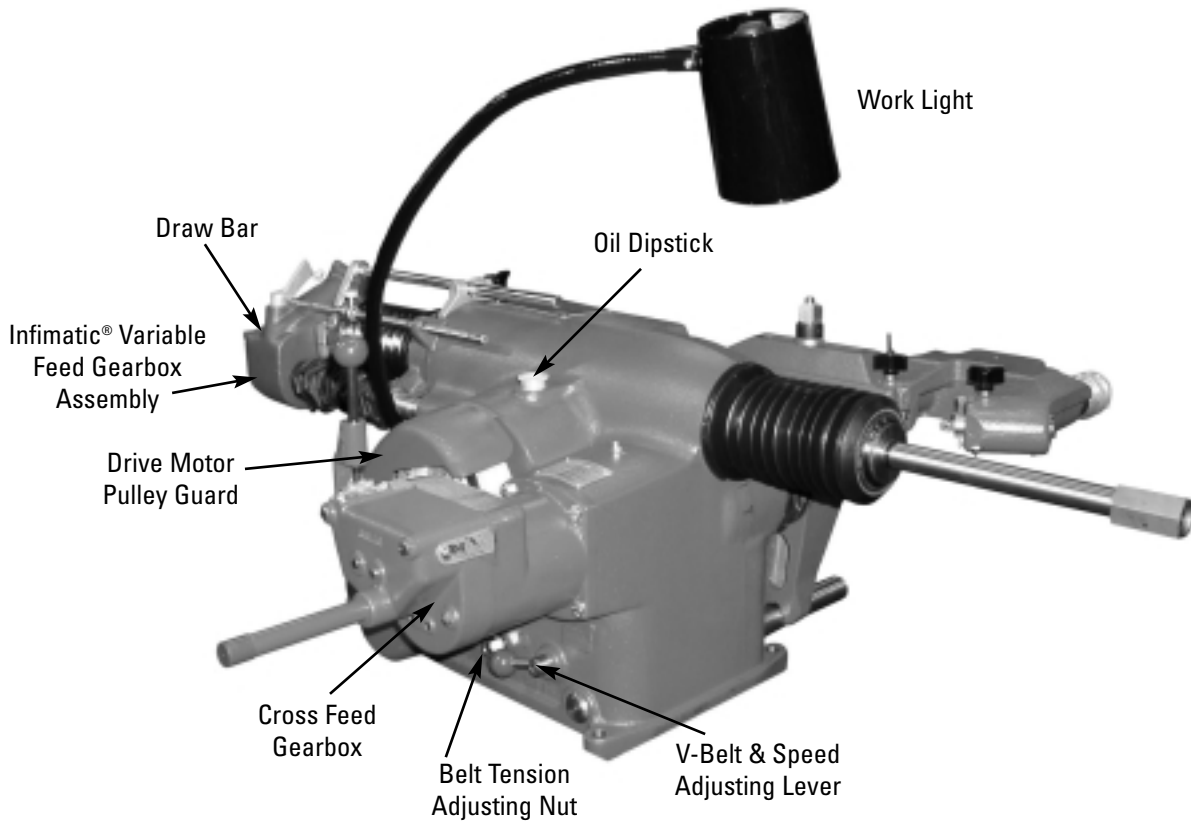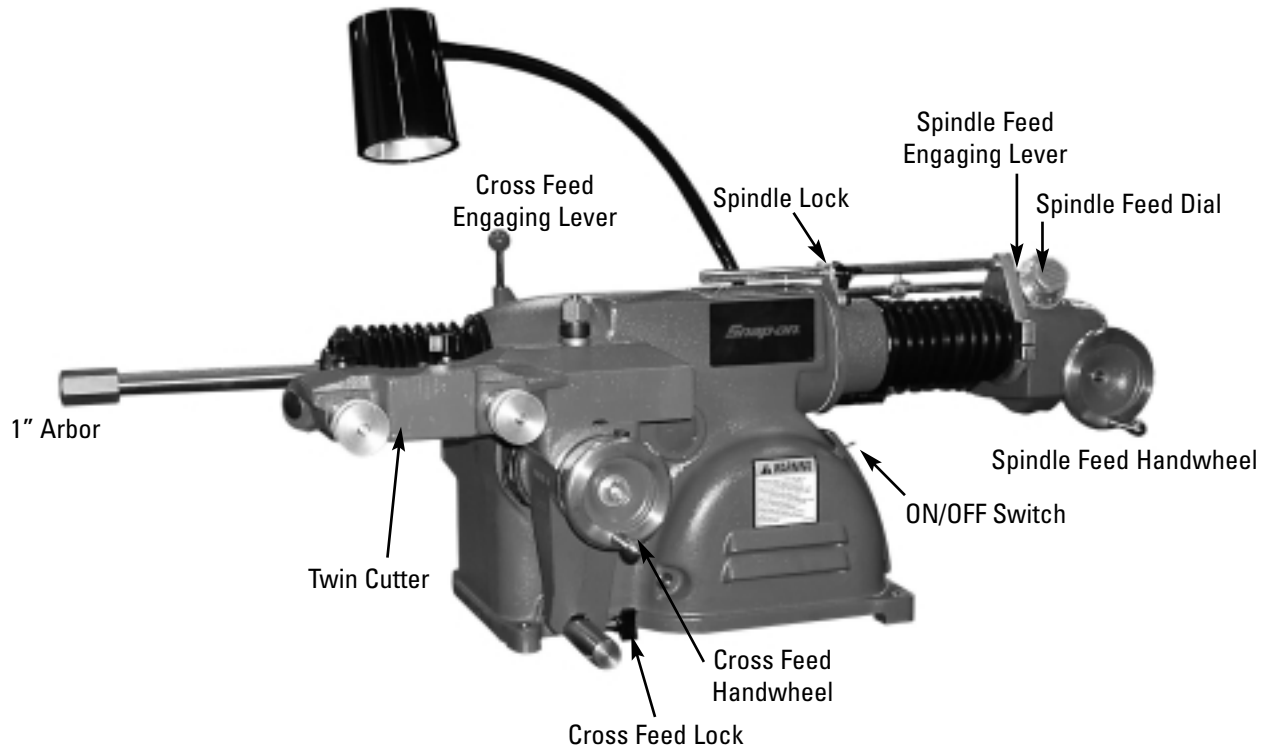

Arbor Installation

The 1" arbor shipped with the lathe has been carefully matched to the lathe during final assembly and testing. Witness marks have been etched onto the arbor and the spindle for precise, repeatable alignment.

The witness marks must be carefully aligned when installing the arbor (Figure 3). A true-running arbor is essential to professional quality brake drum and rotor reconditioning.

1. Locate the witness marks on the arbor and the spindle.

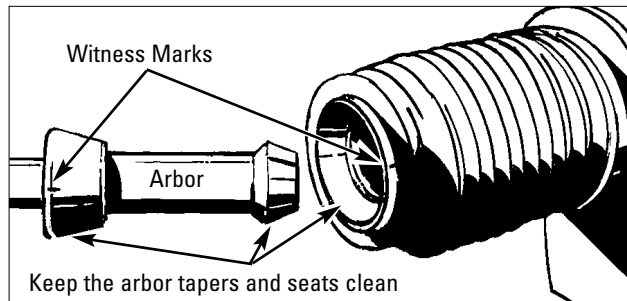


Figure 3 – Align witness marks during arbor installation

2. Insert the arbor into the spindle making sure the witness marks are aligned.

3. Tighten the drawbar (located at the rear of the spindle) to pull the hardened and ground tapers of the arbor into the matching seats in the spindle.

Adapters

Important: Although the adapters, arbor, and spindle are made of top grade steel and are turned, hardened, and precision ground to close tolerances, great care should be taken in their use, handling, and storage. Even the smallest nick, scratch, or loose chip on the machined mating surfaces can cause incorrect rotor mounting alignment. This will cause inaccurate machining.

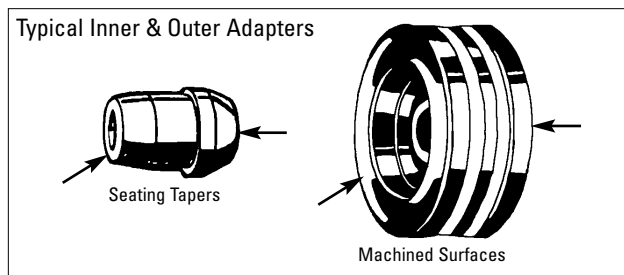


Figure 4 – Use care to avoid damaging mating surfaces

Always inspect the surface, face, and seating tapers of each part before use. Wipe each part clean before and after using it. Carefully correct any flaw with a fine stone. If damage cannot be corrected, replace the part.

Basic Operation

To completely understand drum and rotor turning you must have a knowledge of the lathe itself.

Spindle

The spindle is a motor driven shaft that turns the arbor upon which the brake drum or rotor is mounted. By turning the drum and holding a cutting tool against the inner braking surface, metal can be removed.



Do not try to move any feed levers or dials without the drive motor running. Damage may occur to the gear trains.

Spindle Feed

By operating the spindle feed lever, the spindle will move the mounted brake drum to the left. This feeds the braking surface across the cutting tool as the drum moves away from the tool. Spindle feed may also be done manually using the spindle feed handwheel.

Spindle feed refers to the distance the spindle is pulled per revolution. This speed is adjustable.

Important: Spindle feed must be adjusted with the lathe running.

1. Rotate the spindle feed dial to the desired feed rate. The rate is adjustable to any point between 0.002" (0.05 mm) and 0.020" (0.50 mm).

Spindle Speed

Spindle speed is measured in RPMs and is adjustable. Refer to the specifications listed on page 7 for the RPM rating of each groove on the V-belt pulley.

Spindle Speed Adjustment

This V-belt adjustment must be made with the lathe off.

1. Release the belt tension by moving the V-belt adjusting lever to the right (clockwise).

2. Move the belt to the pulley groove that will give the correct spindle speed for the cut to be taken.

3. Reapply tension to the V-belt by moving the adjusting lever back to the operating position.

Cross Feed

The cross feed draws the tool bit across the face of a brake rotor or flywheel when the cross feed drive is engaged. The cross feed may also be operated manually using the cross feed handwheel.

Brake Lathes

Feed speed refers to the thousandths of an inch the cutting tools move per revolution of the spindle. The cross feed speed is adjustable.

1. Using the 3-position lever, select Fine (0.002" [0.05 mm]) or Coarse (0.010" [0.25 mm]). The Neutral position is the off position (no movement). The cross feed may also be operated manually.

V-Belt Tension and Adjustment

A loose belt can cause slippage when taking heavy cuts. A belt that is too tight can cause vibration and possible sub-standard finishes on machined drums and rotors. Check and adjust belt monthly.

There should be between 1/4" to 1/2" of play in the belt.

1. Position the v-belt speed adjusting lever to the left (counterclockwise) to the fully engaged position.

2. Loosen the adjustment nut.

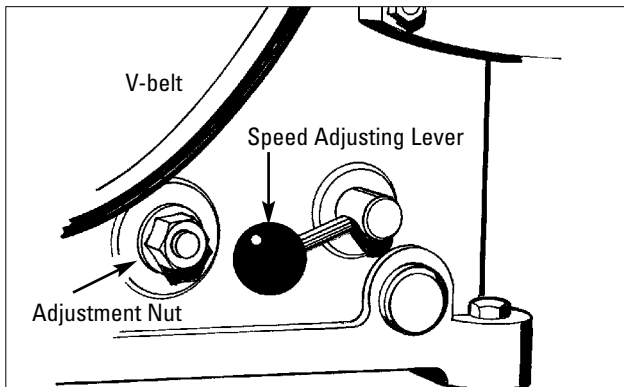


Figure 5 – Engage lever and loosen nut

3. Push in on the belt approximately 1/4" to 1/2" (0.64 to 12.7 mm) and hold.

4. Retighten the adjusting nut.

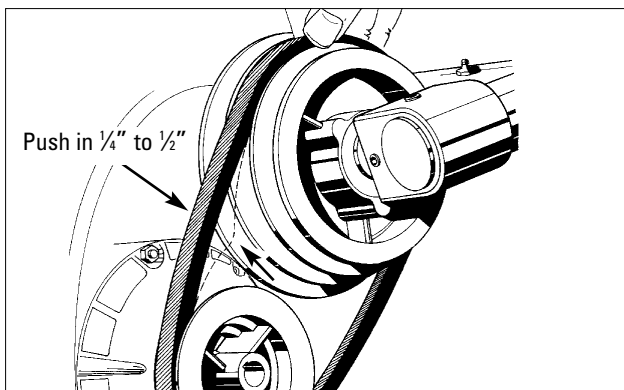


Figure 6 – Press the belt in and tighten adjusting nut

Basic Operation of Handwheels

Clockwise rotation of the spindle feed handwheel retracts the spindle in towards the lathe.

Clockwise rotation of the cross feed handwheel moves the cutting tool in towards the lathe.

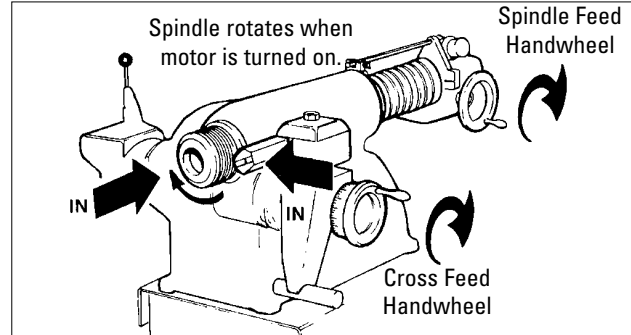


Figure 7 – Clockwise rotation of handwheels

Counterclockwise rotation of the spindle feed handwheel extends the spindle out away from the lathe.

Counterclockwise rotation of the cross feed handwheel moves the cutting tool out away from the lathe.

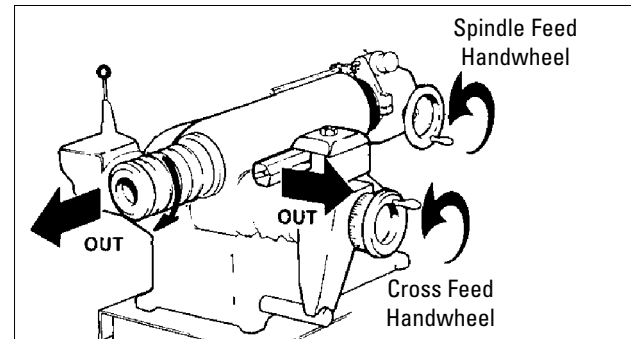


Figure 8 – Counterclockwise rotation of handwheels

Reconditioning Brake Drums

Preparation

1. Measure the diameter of the brake drum with a brake drum micrometer.

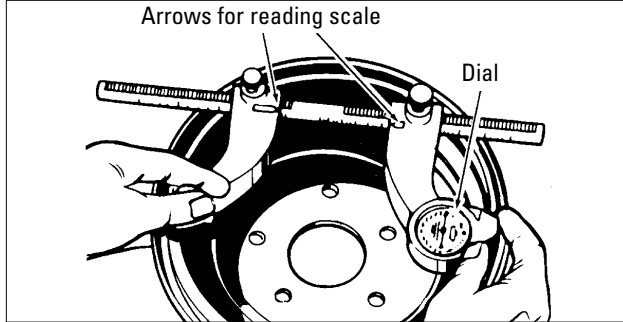


Figure 9 – Measure drum diameter

2. Determine if the drum will be within maximum rebore limits after reconditioning.

Note: Most often, the DISCARD diameter is cast into the brake drum, not the maximum machining diameter.

3. Inspect brake drum. Do not attempt to machine a drum that is damaged or in poor condition.

Mounting Drums

1. Loosen the boring bar clamp nut and push the boring bar all the way into the clamp.

2. Mount the drum on the arbor using the proper adapters, cones, and spacers.

3. Wrap the drum silencer band snugly around the drum. Be sure it covers up to the right-hand edge.

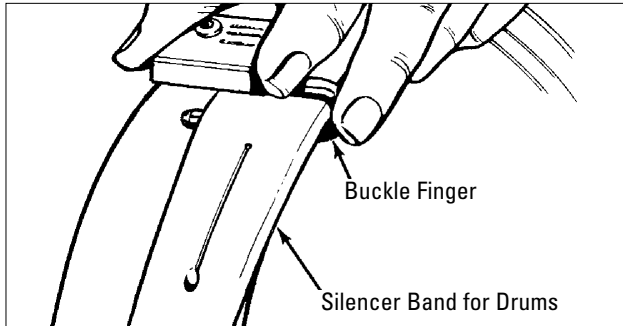


Figure 10 – Attach silencer band

Important: The spindle feed handwheel will not operate unless the spindle feed engagement lever is in the OFF position. Feed should only be adjusted when the spindle is turning.

4. Position the cross slide and spindle by turning their respective handwheels to their maximum clockwise (in) position. Then back off the cross feed handwheel 2 complete turns and the spindle handwheel 4 complete turns.

5. Position the boring bar by loosening the boring bar clamp nut and sliding the boring bar inward toward the drum until the tool bit is close to the drum.

The boring bar position is changed whenever a drum of different diameter is machined.

The entire boring bar clamp may also be swiveled to achieve the best cutting position.

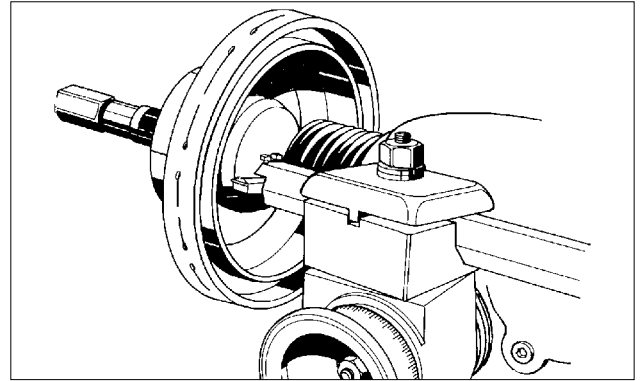


Figure 11 – Positioning the boring bar

6. Turn the drum by hand to make sure that everything is clear.

7. Turn the lathe ON.

8. Advance the tool bit manually until it just contacts the drum surface momentarily and makes a scratch cut.

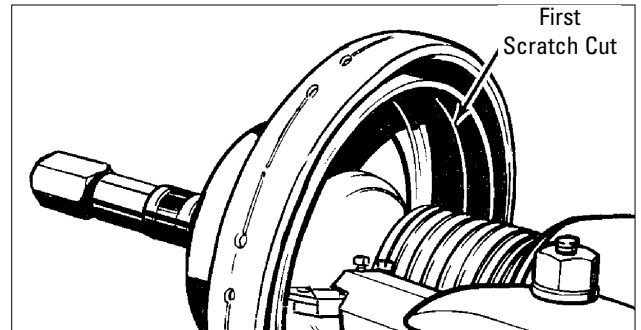


Figure 12 – First scratch cut

9. Loosen the dial lock screw on the cross feed handwheel and set the dial to the diameter of the drum as measured with the micrometer. Tighten the lock screw.

This setting will be the reference used to help determine the drum recondition diameter.

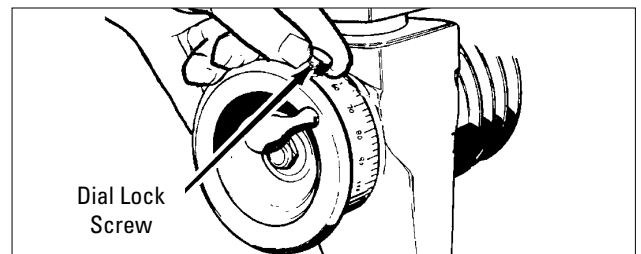


Figure 13 – Set drum diameter measurement

Brake Lathes

Typical Drum Mounting Configurations

Hubbed Brake Drums — Tapered cone adapters fit in the bearing seats, making contact near the middle of the bearing race whenever possible rather than near an edge. Various adapters and spacers may be used to fill out the shaft of the arbor.


Hubless Brake Drums — A cone fits into the center hole of the drum from the inside to center the drum on the arbor. Select a hubless adapter which will fit inside the drum, against the flat lug hole surface and either straddle the boltholes to avoid mounting against a burr, or remove the burrs. Slip the hubless adapter onto the arbor followed by a spring, the cone, the drum, and another hubless adapter. Fill out the shaft with spacers as needed.

Key to Mounting Adapters, Cones, and Related Parts


- A. 1" Arbor
- B. Flange Plate
- C. Spring
- D. Centering Cone
- E. Rotor, Drum or Flywheel
- F. Flange Plate
- G. Spacer(s)
- H. Self-Aligning Spacer
- I. Arbor Nut

Note: The self-aligning spacer should always be used next to the arbor nut when tightening. To avoid overtightening, wrench tighten the arbor nut counterclockwise until the drum and adapters begin to turn on the arbor, then continue to advance the wrench 1/16 of a turn. DO NOT overtighten the arbor nut.

Hubbed Brake Drums

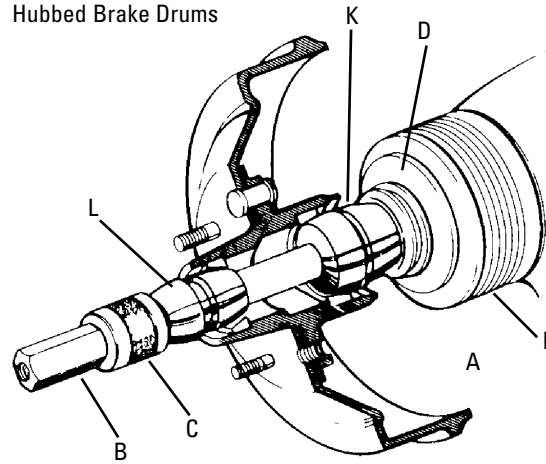

Hubless Brake Drums

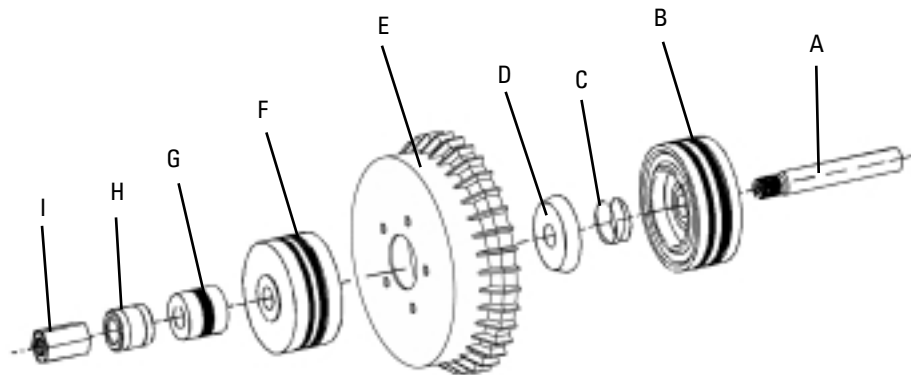

Brake Lathes

10. Back the tool bit off and turn the lathe OFF.

11. Loosen the arbor nut, rotate the drum 1/2 turn (180°) on the arbor and inner adapter, and retighten the nut.

12. Turn the lathe ON.

13. Turn the spindle feed handwheel 1/2 turn in either direction and make a second scratch cut.

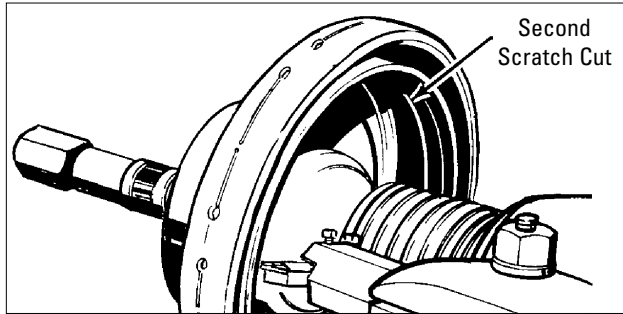


Figure 14 – Second scratch cut

14. Turn the lathe OFF.

15. Examine the scratch cuts.

If the first and second cuts are opposite one another (180° apart), remove the drum from the arbor, check the mounting adapters and arbor for nicks, burrs, or chips, remount the drum, and repeat scratch cut process.

If the scratches are side by side, proceed to step 16.

16. Turn the spindle feed handwheel until the deepest worn groove of the drum lines up with the point of the tool bit.

17. Advance the tool bit into the bottom of the groove by rotating the cross feed handwheel counterclockwise.

Note: These operations may be done with the lathe running.

The depth of cut dial will show the approximate reconditioned diameter of the drum. This measurement must be compared with:

- A.** The maximum rebore limits cast into the drum.
- B.** The measured diameter to determine the best amount of material to be removed in one pass.

18. Determine the depth-of-cut by these general guidelines:

- Roughing cuts should be no deeper than 0.020".
- Finish cuts should be no shallower than 0.004" deep.

19. With the lathe running, set the depth-of-cut dial to the depth desired and lock the cross feed by tightening the lock knob.

20. Set the spindle feed speed while the lathe is running by unlocking the feed dial lock screw and turning the dial. Tighten the lock screw when speed is set.

The rough cut feed range is between 0.006" (0.15 mm) (6 on the dial) to 0.020" (0.50 mm) (20 on the dial).

The finish cut feed range is between 0.002" (0.05 mm) (2 on the dial) and 0.006" (0.15 mm) (6 on the dial).

21. Set the feed shut-off by sliding it on the shaft to a point that approximately equals the depth of the drum and tightening it in place. The feed will stop when it reaches this point.

22. Engage the feed lever to begin drum reconditioning.

Brake Lathes


Reconditioning Disc Brake Rotors

Preparation

1. Inspect the rotor carefully for scoring, rust ridges (at the inner and outer circumference of the rotor), and hard spots. Any excessive wear or deformity should be noted and, if not within acceptable limits, the rotor should be replaced.

2. Use a micrometer to check the thickness of the rotor at no less than 3 points around the circumference about 1" (2.54 mm) in from the outer diameter.

If the rotor thickness varies between readings, it should be reconditioned. However, if the thickness is less than the minimum established by the manufacturer, or if it will be less after reconditioning, the rotor should be replaced.

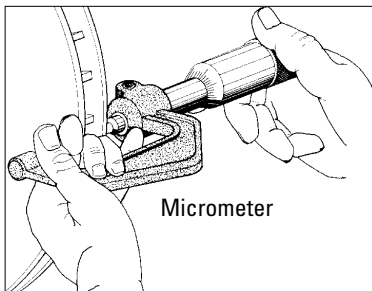

Note: Most often the DISCARD thickness dimension is cast or stamped into the rotor, not the minimum machine-to thickness.

Figure 15 – Measure rotor thickness

Model 6950 Twin Cutter

1. Mount the twin cutter on the cross feed with the stud bolt extending through the cast slot. The slot helps center the twin cutter to the rotor.

2. Secure the twin cutter to the cross feed with self-aligning nut and washer assembly. Tighten the nut firmly.

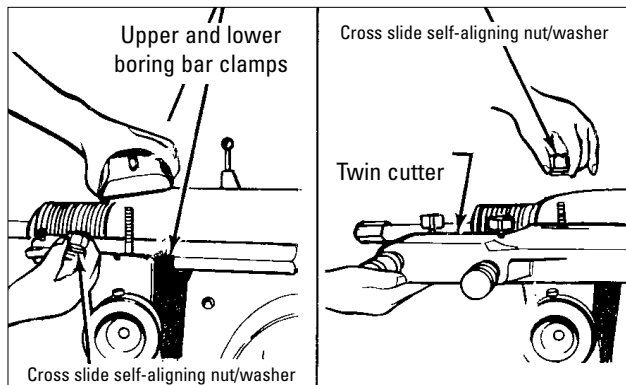


Figure 16 – Install the twin cutter

Rotor Mounting

Review the descriptions of mounting a brake drum on page 12 and the illustrations of typical rotor mounting configurations on page 15. The same directions apply when mounting a brake rotor. Hubbed rotors are mounted on adapters that fit into the bearing races. Hubless rotors use a cone in the center hole and a hubless adapter on each side of the rotor. Spacers are used to fill out the arbor shaft so that the arbor nut can be tightened. The setups illustrated are typical of the many mounting configurations necessary to meet the requirements of brake rotor reconditioning. The adapters, cones, and spacers supplied with the lathe will allow reconditioning of the majority of the rotors found on current production vehicles. Optional adapters, cones, and spacers are available to meet special needs.





Note: Adapters may also be used as spacers to fill out the arbor shaft if care is taken to prevent damage to their machined surfaces.

The patented self-aligning spacer prevents diagonal thrust on the adapters. The self-aligning spacer should always be used adjacent to the arbor nut.

Brake Lathes

Typical Rotor Mounting Configurations

- Ⓐ - 1" Arbor
- Ⓑ - Arbor Nut
- Ⓒ - Self-Aligning Spacer
- Ⓓ - Spacer
- Ⓔ - Spring
- Ⓕ - Flange Plate
- Ⓖ - Flange Plate
- Ⓗ - Centering Cone
- Ⓘ - Small Double Taper Adapter
- ⓵ - Large Double Taper Adapter
- Ⓚ - Adapter, Used as Spacer

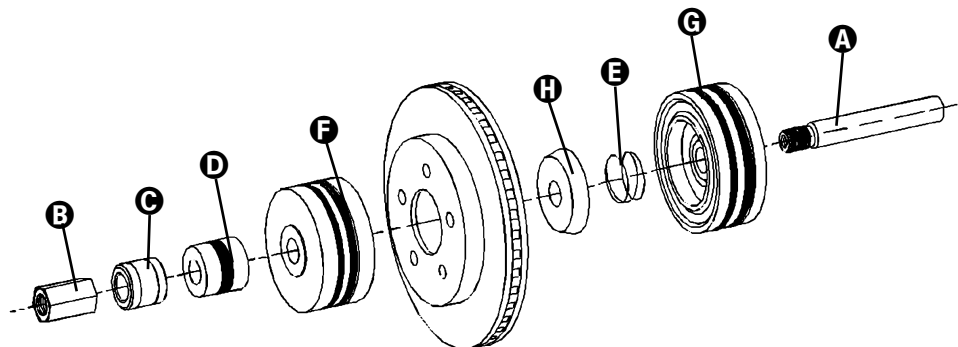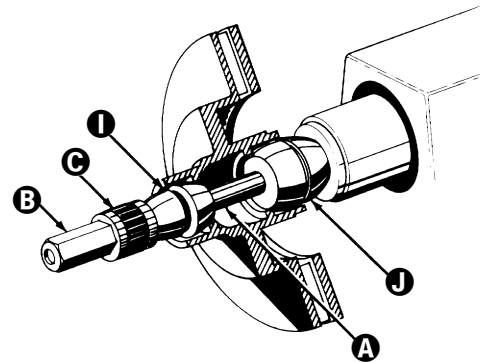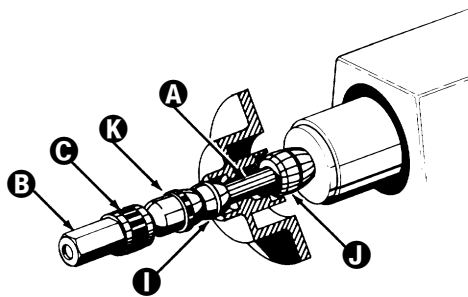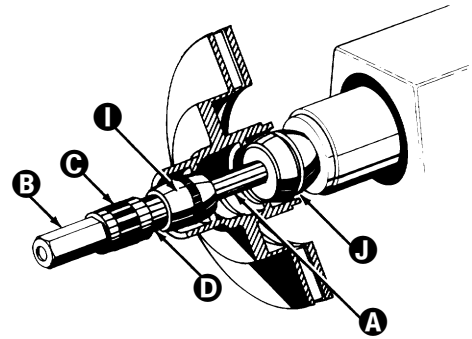

Brake Lathes

Set Up and Reconditioning Rotors

1. Install a silencer band on the mounted rotor. Stretch the band around the rotor and hook the metal loop over a lead weight.

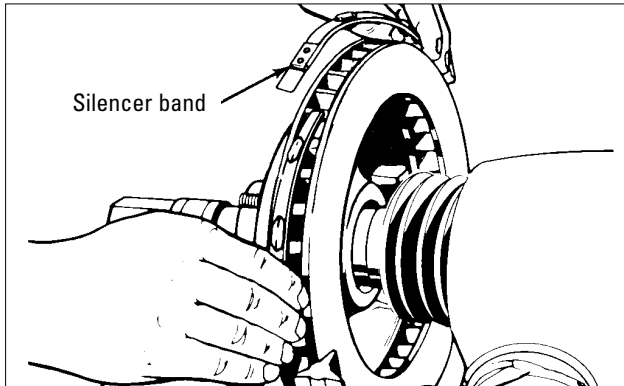


Figure 17 – Attach silencer band

2. Center the twin cutter to the rotor. Loosen the stud nut and adjust the twin cutter so that the rotor is centered between the tool bits. The slot of the twin cutter should be approximately parallel to the lathe spindle. Tighten the stud nut firmly.

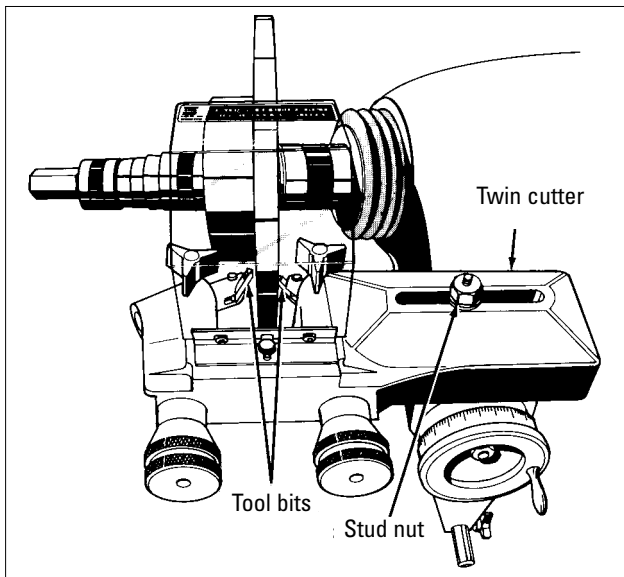


Figure 18 – Center the twin cutter

3. Install the safety shield. Review the cautions and dangers section and the general safety information at the beginning of this manual. The safety shield is easily screwed onto the twin cutter in the threaded mounting hole provided.



Always wear safety glasses or a face shield. Cutting or grinding on an exposed surface such as a rotor will produce flying chips and debris.

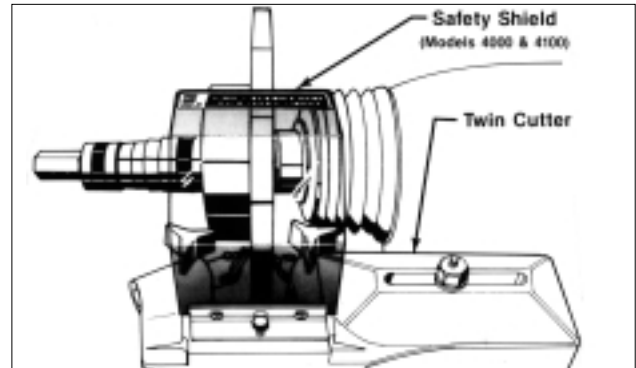


Figure 19 – Attach the safety shield

4. Adjust the drive belt to match the rotor size. Use the outer pulley groove for passenger car and most light duty truck rotors. Choose one of the inner pulley grooves when machining medium duty and larger truck rotors and some solid rotors.

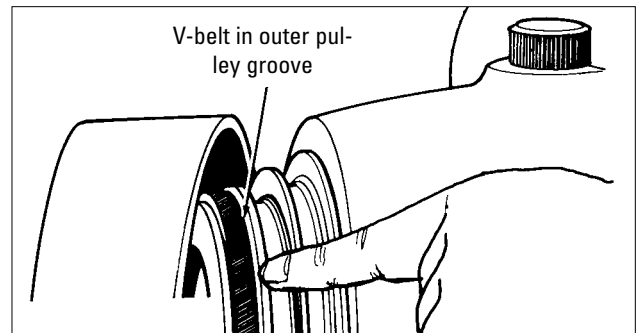


Figure 20 – Adjust drive belt location

5. Make sure that the tool bits clear the rotor surfaces and the silencer band. Give the rotor a full turn by hand and watch for clearance all the way around.

6. Turn the lathe ON.

7. Turn each tool bit control (the outer knurled knobs) clockwise until the tool bits just contact the rotor surfaces.

8. When the tool bits make contact, rotate each of the inner depth-of-cut collars to zero and back the tool bits away from the rotor.

From this point on, all tool adjustments will be made with the tool bit controls. Then inner depth-of-cut collars will be the reference and should not be moved.

Brake Lathes

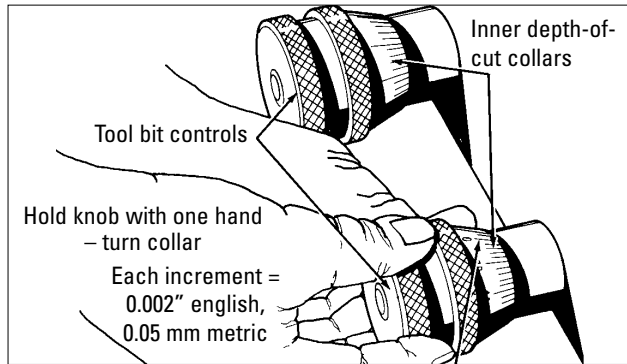


Figure 21 – Tool bit controls

9. Turn the cross feed handwheel until the tool bits are at mid-point of the rotor face.

10. Turn the left hand tool bit control until the tool bit contacts the rotor surface and makes a scratch cut. After the cut is made, back the tool bits off and turn the lathe OFF.

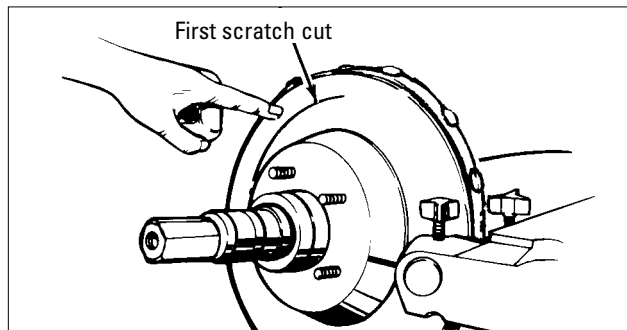


Figure 22 – First scratch cut

The scratch will usually appear as an incomplete circle. This is caused by runout or wobble due to rotor condition, or by the way the rotor is mounted on the arbor.

11. Check rotor mounting by loosening the arbor nut and turning the rotor 180° by hand on the arbor. Make sure the inside adapter does not rotate along with the rotor. Then retighten the arbor nut, turn the cross feed handwheel back 1/2 turn, turn the lathe ON, and repeat step 10 to make a second scratch cut.

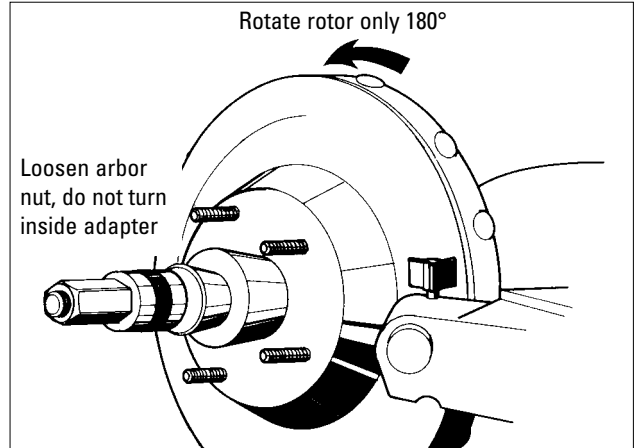


Figure 23 – Rotate rotor 180°

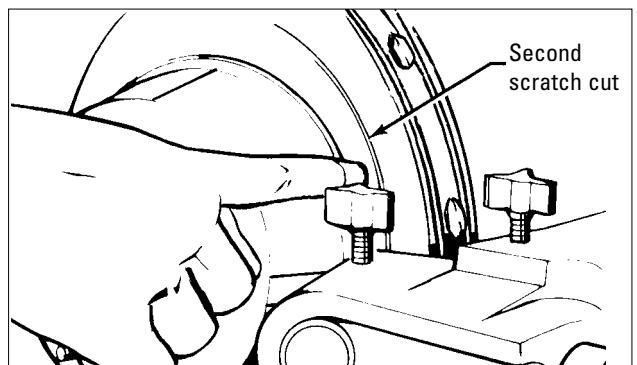


Figure 24 – Second scratch cut

12. If the scratch cuts are side-by-side, the runout or wobble is caused by rotor condition. A dial indicator may be used to compare rotor runout with manufacturer's specifications.

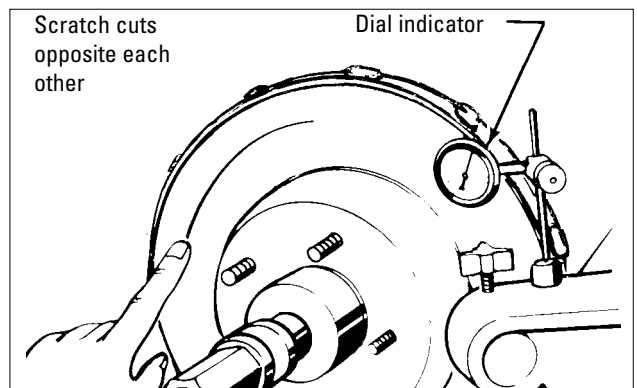


Figure 25 – Using a dial indicator

13. If the scratch cuts are opposite one another (180°), the rotor may not be properly mounted on the arbor. Remove the rotor and examine the arbor and all adapters for nicks, burrs, chips, dirt, or rust. Inspect the rotor hub for loose or damaged bearing cups. Clean, repair, remount, or replace as necessary.

Brake Lathes

14. Recheck the setting of the depth-of-cut collars which were set to zero earlier by moving the tool bits inward until they just contact the surfaces of the rotor. The collars should be at zero. Reset the collars if necessary.


15. Turn the cross feed handwheel clockwise until the tool bits are near the rotor hub.

16. Turn the lathe ON.

17. Turn both tool bit controls to the desired depth-of-cut and lock them in position by tightening the red lock knobs above the tool bits.

Note: Either rough or finish cuts may be taken to resurface a rotor. Generally, finish cuts should be 0.004" (0.10 mm) to 0.006" (0.15 mm) per side. Very shallow cuts of less than 0.004" (10 mm) per side tend to reduce tool bit life because the heat generated during reconditioning isn't transferred to the rotor efficiently. Rough cuts may be taken from 0.006" to 0.010" per side.

18. Engage the automatic cross feed by moving the lever to the desired speed. The cross feed will stop automatically when the cutting tools have moved all the way across the face of the rotor.

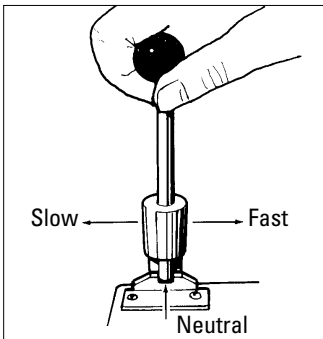

Note: For roughing cuts, move the cross feed lever to the FAST position.

Figure 26 – Engage automatic cross feed

Maintenance and Service

Oiling

The lathe is shipped from the factory with the correct amount and type of oil. Check oil level frequently, and refill as necessary with EP-80-90 gear oil.

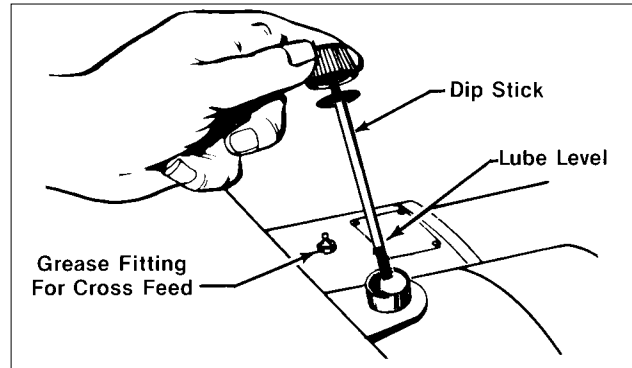


Figure 27 – Oiling

After every 500 hours of use, drain the oil and refill to the appropriate level on the dipstick with clean EP-80-90 gear oil. Use the oil drain plug on the front of the lathe to drain the old oil.

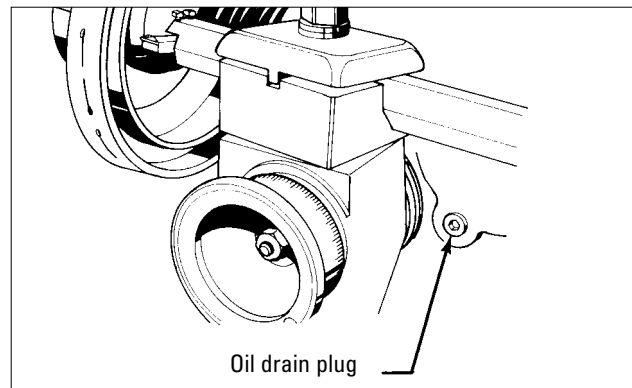


Figure 28 – Drain plug location

The Infimatic® Variable Feed Gearbox and the disc brake feed mechanism assemblies are filled with a special lubricant and need no further internal lubrication.

Lubricate the cross feed once each month with an automotive chassis grease. Pump the grease into an automotive chassis grease. Pump the grease into the fitting until clean grease comes out the relief slot at the base of the fitting.

Brake Lathes

Use a hand pump grease gun only. A high pressure gun can burst the lathe casting.

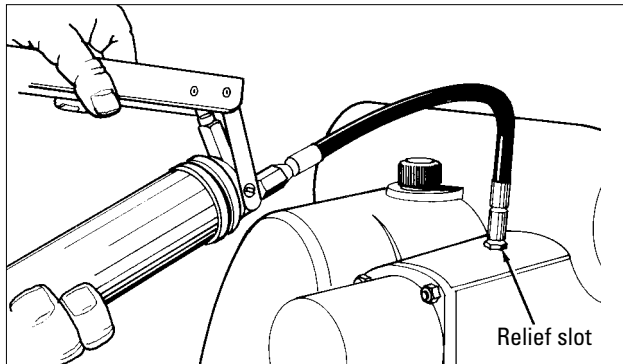


Figure 29 – Cross feed grease fitting

Grease the lead screw drive monthly. Locate the lead screw drive by pulling the protective boot back.

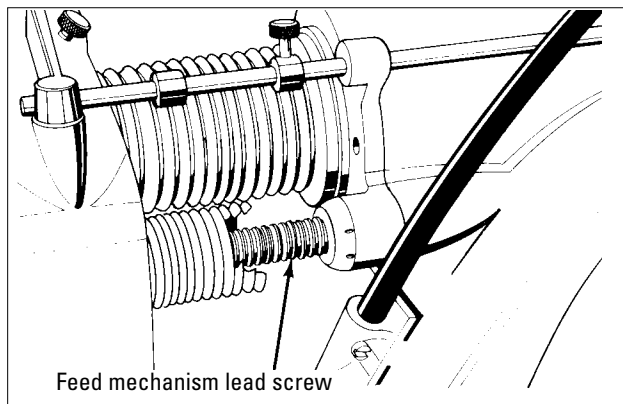


Figure 30 – Lead screw drive

Oil exposed metal parts periodically to prevent rust.

Cleaning

Keep the lathe as clean as possible for trouble-free operation, as well as safety and longer lathe life. Use a brush to sweep metal chips and dust off the lathe.

Do not use compressed air to blow the lathe clean. Chips and dust may be driven between machined parts and into bearings, causing undue wear.

Care of Arbors and Adapters

Although the adapters, arbors, and spindle are made of top grade steel and are turned, hardened, and precision ground to close tolerances, great care should be taken in their use, handling, and storage. Even the smallest nick, scratch, or loose chip can cause incorrect rotor or drum alignment, resulting in inaccurate reconditioning.

Remove all adapters from the arbor after reconditioning a drum or rotor and wipe them clean – especially the inboard adapter. When a finished drum or rotor is removed from the arbor, the inboard adapter may move slightly away from the face of the arbor and allow metal chips to fall into the opening, causing a poor mounting for the next drum or rotor.

Regularly inspect the faces and seating tapers of the adapters for nicks and scratches, correct any flaw with a fine stone. If the damage cannot be corrected, replace the adapter. Handle the adapters and arbors with care and store them on individual hooks. Do not throw them into a box. The adapters are designed for mounting drums and rotors only. Do not misuse the adapters.

Shear Gear Replacement

The shear gear, on export models, is located in the drive housing under the dot plug cover. It is designed to “strip out” and prevent gearbox damage should a tool accidentally jam.

Remove the dot plug button. Remove the C-clip. Remove the shear gear. Remove any stripped teeth from the drive housing. Install the new gear. The concave side of the C-clip faces the gear to maintain pressure. Replace the dot plug button.

Snap-on Tools Company

Limited One (1) Year Warranty

Snap-on Tools Company (the "Seller") warrants only to the original purchaser that under normal use, care and service, the Equipment (except as otherwise provided herein) shall be free from defects in material and workmanship for one year from the date of original invoice. Arbor runout is warranted for 30 calendar days from the date of original purchase. Belts are warranted for 90 calendar days from the date of original purchase.

SELLER'S OBLIGATIONS UNDER THIS WARRANTY ARE LIMITED SOLELY TO THE REPAIR OR, AT SELLER'S OPTION, REPLACEMENT OF EQUIPMENT OR PARTS WHICH TO SELLER'S SATISFACTION ARE DETERMINED TO BE DEFECTIVE AND WHICH ARE NECESSARY, IN SELLER'S JUDGMENT, TO RETURN THIS EQUIPMENT TO GOOD OPERATING CONDITION. NO OTHER WARRANTIES, EXPRESS OR IMPLIED OR STATUTORY, INCLUDING WITHOUT LIMITATION ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, SHALL APPLY AND ALL SUCH WARRANTIES ARE HEREBY EXPRESSLY DISCLAIMED.

This Warranty does not cover (and separate charges for parts, labor, and related expenses shall apply to) any damage to, malfunctioning, inoperability or improper operation of the Equipment caused by, resulting from or attributable to (A) abuse, misuse or tampering; (B) alteration, modification or adjustment of the Equipment by other than Seller's authorized representatives; (C) installation, repair or maintenance (other than specified operator maintenance) of the Equipment or related equipment, attachments, peripherals or optional features by other than Seller's authorized representatives; (D) improper or negligent use, application, operation, care, cleaning, storage or handling; (E) fire, water, wind, lightning or other natural causes; (F) adverse environmental conditions, including, without limitation, excessive heat, moisture, corrosive elements, dust or other air contaminants, radio frequency interference, electric power failure, power line voltages beyond those specified for the Equipment, unusual physical, electrical or electromagnetic stress and/or any other condition outside of the Seller's environmental specifications; (G) use of the Equipment in combination or connection with other equipment, attachments, supplies or consumables not manufactured or supplied by Seller; or (H) failure to comply with any applicable federal, state or local regulation, requirement or specification governing emission analyzers and related supplies or consumables.

Repairs or replacements qualifying under this Warranty will be performed on regular business days during Seller's normal working hours within a reasonable time following Purchaser's request. All requests for Warranty service must be made during the stated Warranty period. This Warranty is non-transferable.

Brake Lathe EEER312ABP includes:

EEER312A Brake Lathe
AMM2500 Bench Kit (Bench, sign, tool board, chip funnel and bucket)
AMM0002 Basic Adapter Kit

Brake Lathe EEER312ADP includes:

EEER312A Brake Lathe
AMM2500 Bench Kit (Bench, sign, tool board, chip funnel and bucket)
AMM0005 Deluxe Adapter Kit

For Installation, Service & Parts, call 1-800-688-9240

Snap-on® is a trademark of Snap-on Technologies, Inc.
2002 Snap-on Technologies, Inc.
Manufactured in USA for Snap-on
2801 – 80th Street, Kenosha, WI 53141-1410